













<b>Owner</b>	<b>Customer</b>	<b>Upstream MH</b>	<b>Downstream MH</b>	<b>Date</b>	<b>Time</b>
		3UM33	3UM37	05-05-2021	9:22 AM
<b>Surveyor</b>	<b>Street</b>		<b>City</b>	<b>Weather</b>	
NICK	SANDHOLM		GENEVA	Dry	
<b>Size</b>	<b>Material</b>	<b>Sewer Use</b>	<b>Purpose</b>	<b>Length</b>	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
<b>Comments</b>				<b>Pre-Cleaning</b>	<b>TV Length</b>
				Jetting	269.3

	Ftg.	Code	Description	Position	Severity	Comment
 	0.0	MH	Manhole	12		
	2.2	L	Lateral	2		STUB
	5.1	R	Roots	2 to 4	3	
	7.6	R	Roots	8 to 4	3	
	10.5	R	Roots		3	
	11.3	C	Crack	3 to 4	2	
 	42.3	L	Lateral	2		STUB
	44.9	L	Lateral	1		
	82.1	C	Crack	2 to 5	2	
	98.0	L	Lateral	11		STUB
	113.4	L	Lateral	2		
 	137.0	DP	Deposits		2	
	141.0	L	Lateral	12		
	143.4	L	Lateral	2		STUB
	147.8	DP	Deposits	7 to 10	2	
	149.4	DP	Deposits		2	
 	171.9	DP	Deposits		2	
	174.6	DP	Deposits		2	
	181.5	L	Lateral	11		STUB
	183.8	L	Lateral	2		STUB
	193.8	L	Lateral	10		
 	227.9	L	Lateral	2		
	227.9	R	Roots		3	
	231.7	L	Lateral	2		STUB
	234.6	L	Lateral	2		STUB
	235.9	C	Crack	1 to 8	2	
	269.3	MH	Manhole	12		

<b>Owner</b>	<b>Customer</b>	<b>Upstream MH</b>	<b>Downstream MH</b>	<b>Date</b>	<b>Time</b>
		3UM33	3UM37	05-05-2021	9:22 AM
<b>Surveyor</b>	<b>Street</b>		<b>City</b>	<b>Weather</b>	
NICK	SANDHOLM		GENEVA	Dry	
<b>Size</b>	<b>Material</b>	<b>Sewer Use</b>	<b>Purpose</b>	<b>Length</b>	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
<b>Comments</b>				<b>Pre-Cleaning</b>	<b>TV Length</b>
				Jetting	269.3

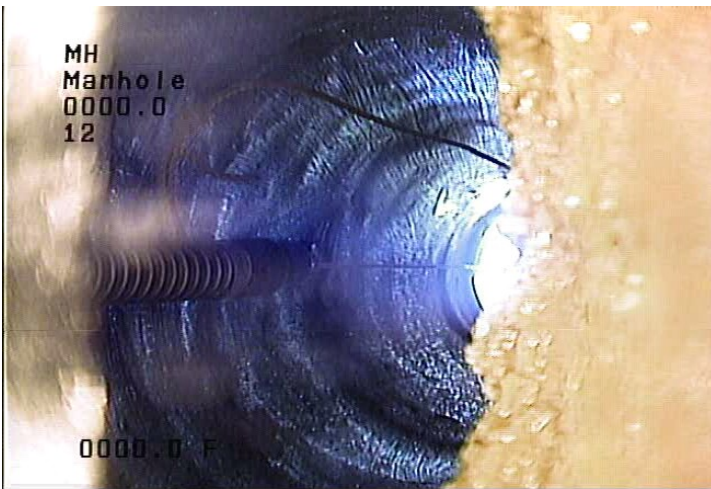

MH - Manhole @ 0.0 ft.

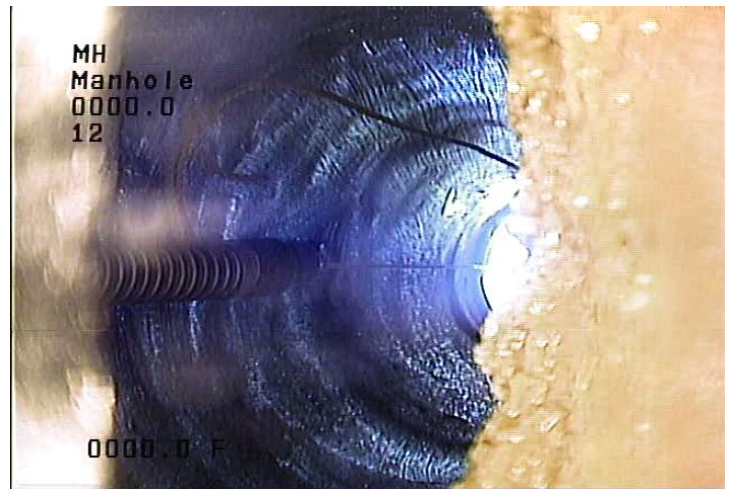

L - Lateral @ 2.2 ft. STUB




R - Roots @ 5.1 ft.




R - Roots @ 7.6 ft.


<b>Owner</b>	<b>Customer</b>	<b>Upstream MH</b>	<b>Downstream MH</b>	<b>Date</b>	<b>Time</b>
		3UM33	3UM37	05-05-2021	9:22 AM
<b>Surveyor</b>	<b>Street</b>	<b>City</b>	<b>Weather</b>		
NICK	SANDHOLM	GENEVA	Dry		
<b>Size</b>	<b>Material</b>	<b>Sewer Use</b>	<b>Purpose</b>	<b>Length</b>	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
<b>Comments</b>				<b>Pre-Cleaning</b>	<b>TV Length</b>
				Jetting	269.3

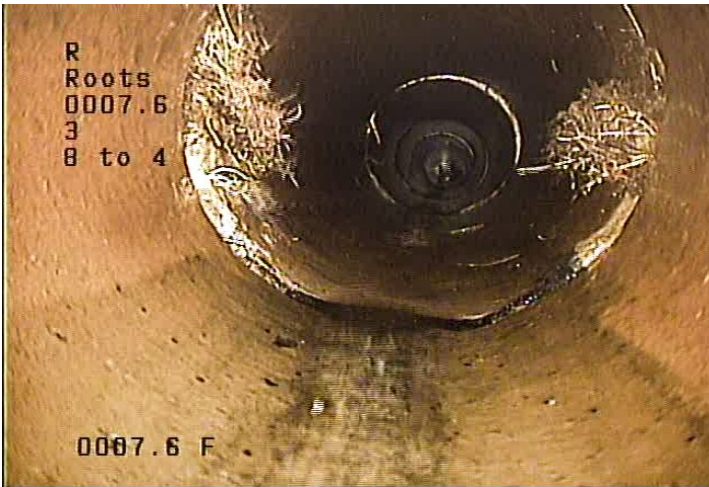


R - Roots @ 10.5 ft.

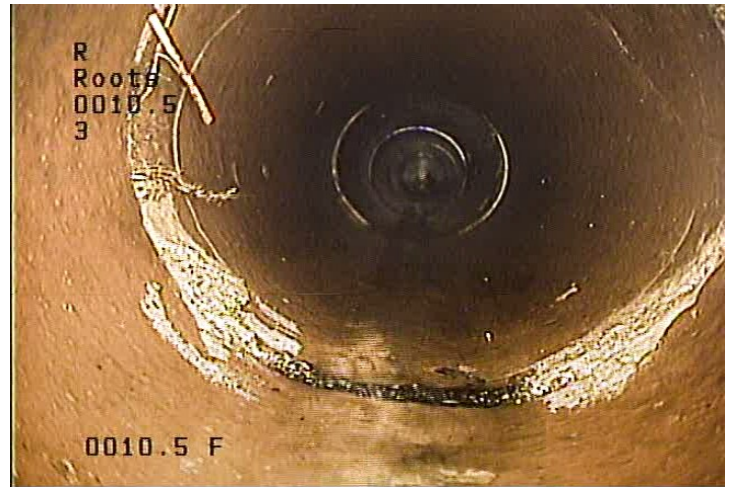

C - Crack @ 11.3 ft.

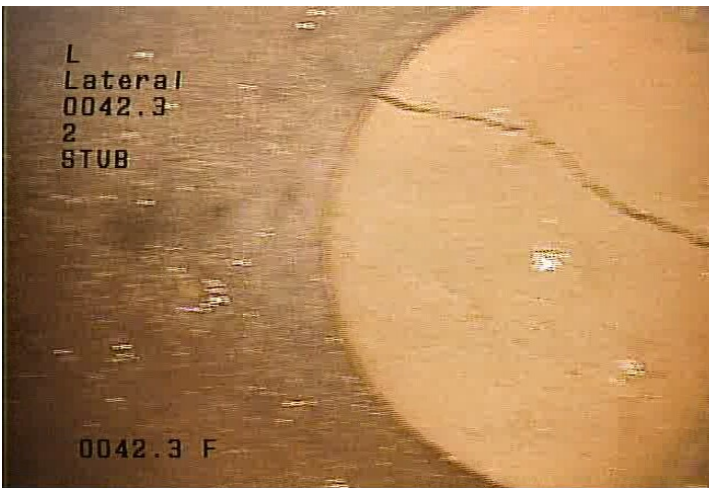

L - Lateral @ 42.3 ft. STUB

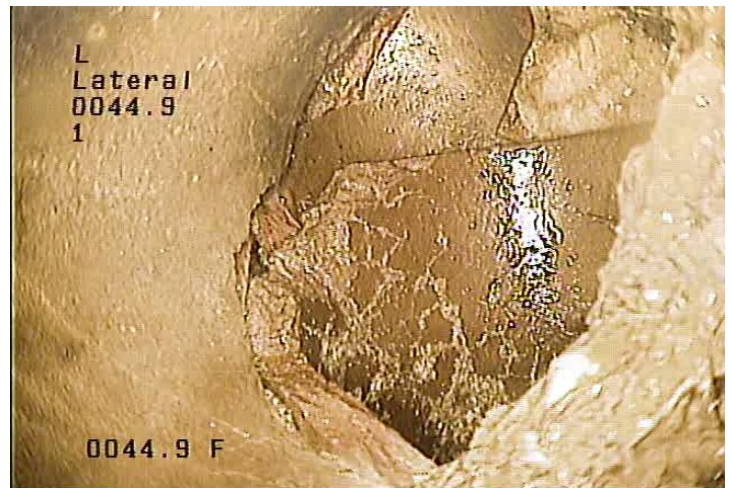

L - Lateral @ 44.9 ft.

<b>Owner</b>	<b>Customer</b>	<b>Upstream MH</b>	<b>Downstream MH</b>	<b>Date</b>	<b>Time</b>
		3UM33	3UM37	05-05-2021	9:22 AM
<b>Surveyor</b>	<b>Street</b>	<b>City</b>	<b>Weather</b>		
NICK	SANDHOLM	GENEVA	Dry		
<b>Size</b>	<b>Material</b>	<b>Sewer Use</b>	<b>Purpose</b>	<b>Length</b>	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
<b>Comments</b>	<b>Pre-Cleaning</b>	<b>TV Length</b>			
	Jetting	269.3			



C - Crack @ 82.1 ft.



L - Lateral @ 98.0 ft. STUB



L - Lateral @ 113.4 ft.



DP - Deposits @ 137.0 ft.

<b>Owner</b>	<b>Customer</b>	<b>Upstream MH</b>	<b>Downstream MH</b>	<b>Date</b>	<b>Time</b>
		3UM33	3UM37	05-05-2021	9:22 AM
<b>Surveyor</b>	<b>Street</b>	<b>City</b>		<b>Weather</b>	
NICK	SANDHOLM	GENEVA		Dry	
<b>Size</b>	<b>Material</b>	<b>Sewer Use</b>	<b>Purpose</b>	<b>Length</b>	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
<b>Comments</b>				<b>Pre-Cleaning</b>	<b>TV Length</b>
				Jetting	269.3




L - Lateral @ 141.0 ft.



L - Lateral @ 143.4 ft. STUB




DP - Deposits @ 147.8 ft.

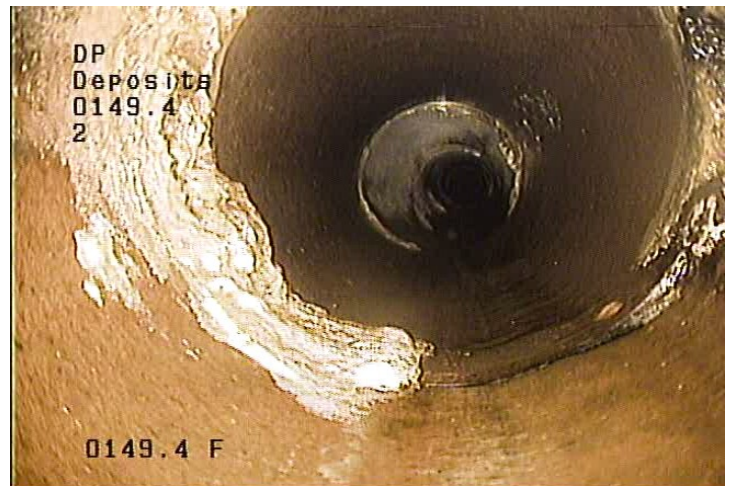


DP - Deposits @ 149.4 ft.


<b>Owner</b>	<b>Customer</b>	<b>Upstream MH</b>	<b>Downstream MH</b>	<b>Date</b>	<b>Time</b>
		3UM33	3UM37	05-05-2021	9:22 AM
<b>Surveyor</b>	<b>Street</b>		<b>City</b>	<b>Weather</b>	
NICK	SANDHOLM		GENEVA	Dry	
<b>Size</b>	<b>Material</b>	<b>Sewer Use</b>	<b>Purpose</b>		<b>Length</b>
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
<b>Comments</b>				<b>Pre-Cleaning</b>	<b>TV Length</b>
				Jetting	269.3

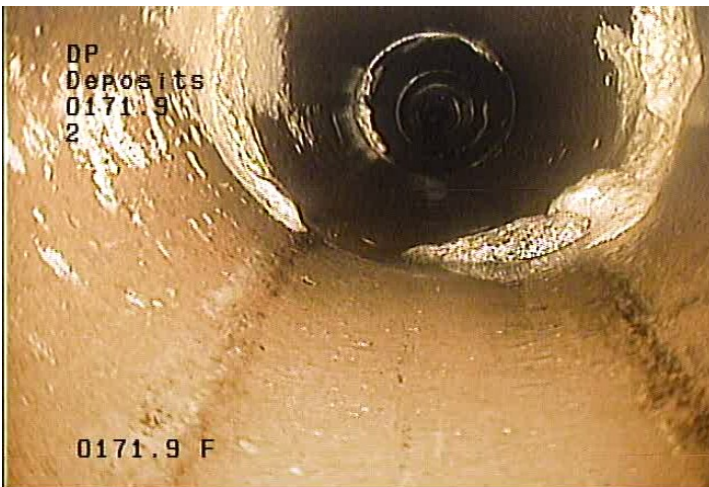


DP - Deposits @ 171.9 ft.

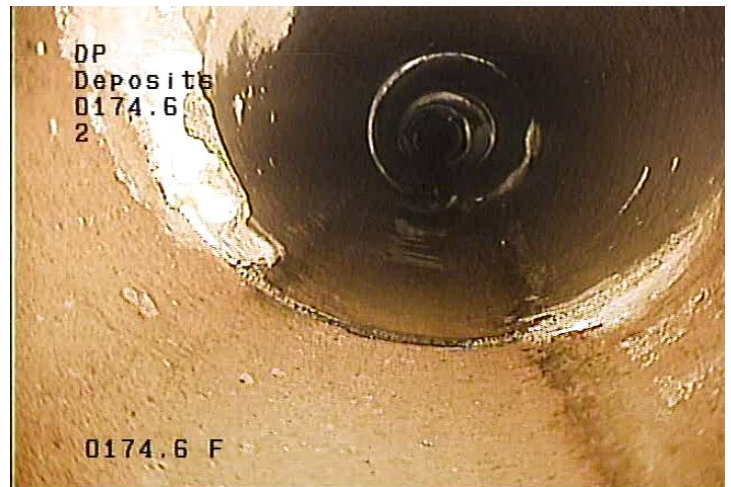

DP - Deposits @ 174.6 ft.

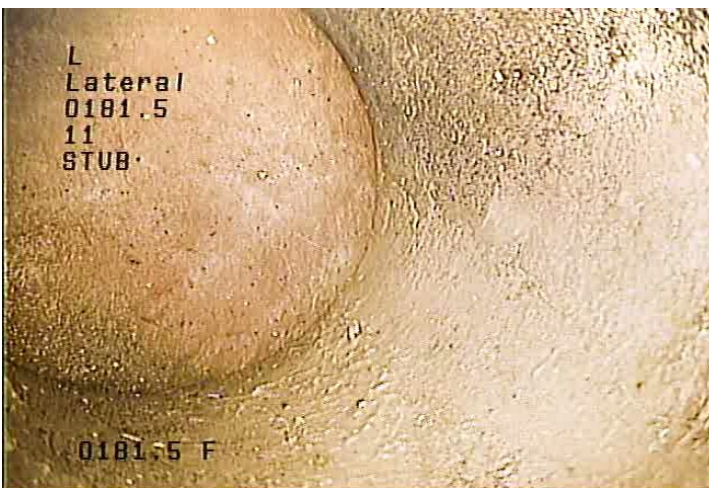


L - Lateral @ 181.5 ft. STUB

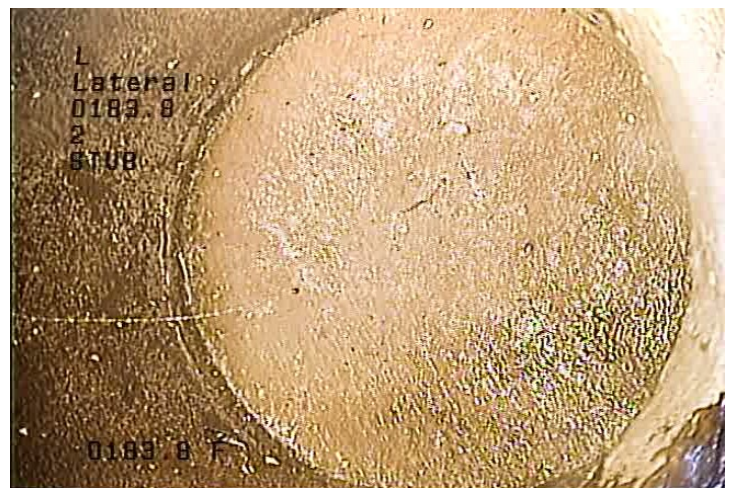

L - Lateral @ 183.8 ft. STUB

<b>Owner</b>	<b>Customer</b>	<b>Upstream MH</b>	<b>Downstream MH</b>	<b>Date</b>	<b>Time</b>
		3UM33	3UM37	05-05-2021	9:22 AM
<b>Surveyor</b>	<b>Street</b>	<b>City</b>	<b>Weather</b>		
NICK	SANDHOLM	GENEVA	Dry		
<b>Size</b>	<b>Material</b>	<b>Sewer Use</b>	<b>Purpose</b>	<b>Length</b>	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
<b>Comments</b>				<b>Pre-Cleaning</b>	<b>TV Length</b>
				Jetting	269.3

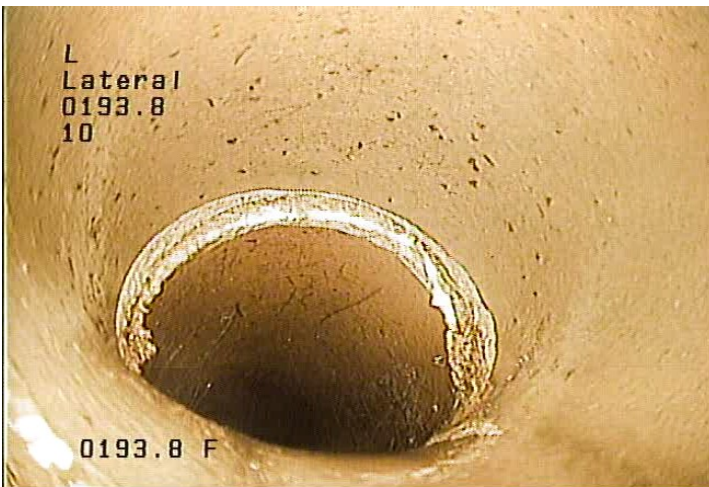


L - Lateral @ 193.8 ft.



L - Lateral @ 227.9 ft.



R - Roots @ 227.9 ft.

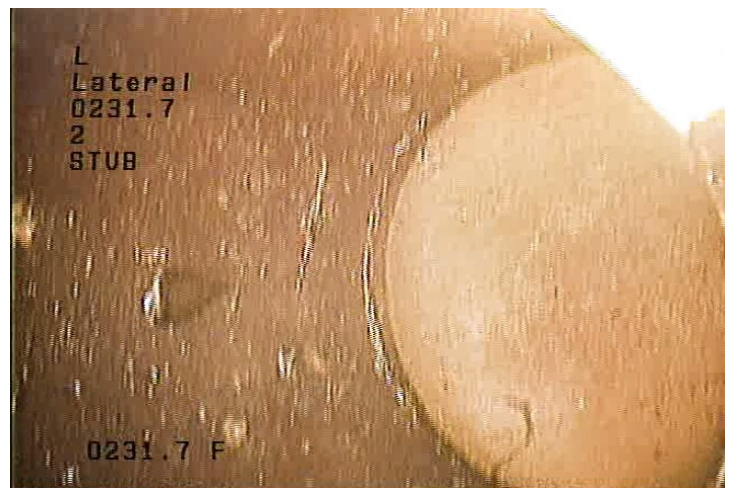

L - Lateral @ 231.7 ft. STUB


<b>Owner</b>	<b>Customer</b>	<b>Upstream MH</b>	<b>Downstream MH</b>	<b>Date</b>	<b>Time</b>
		3UM33	3UM37	05-05-2021	9:22 AM
<b>Surveyor</b>	<b>Street</b>	<b>City</b>	<b>Weather</b>		
NICK	SANDHOLM	GENEVA	Dry		
<b>Size</b>	<b>Material</b>	<b>Sewer Use</b>	<b>Purpose</b>	<b>Length</b>	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
<b>Comments</b>				<b>Pre-Cleaning</b>	<b>TV Length</b>
				Jetting	269.3



L - Lateral @ 234.6 ft. STUB



C - Crack @ 235.9 ft.

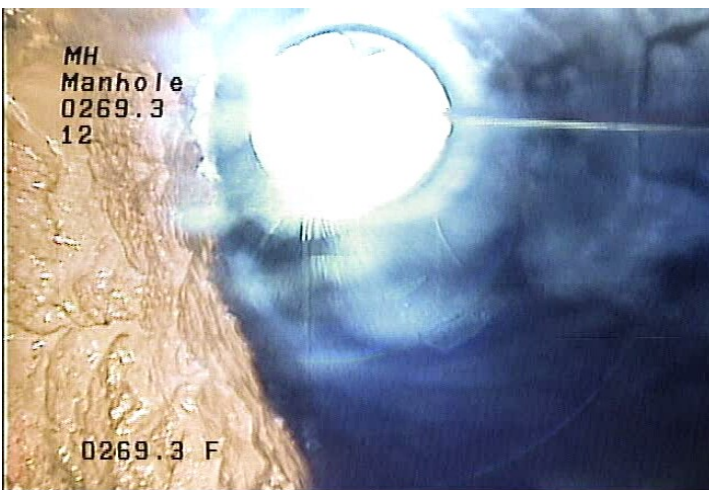


MH - Manhole @ 269.3 ft.

<b>Owner</b>	<b>Customer</b>	<b>Upstream MH</b>	<b>Downstream MH</b>	<b>Date</b>	<b>Time</b>
		3UM33	3UM37	05-05-2021	9:22 AM
<b>Surveyor</b>	<b>Street</b>	<b>City</b>	<b>Weather</b>		
NICK	SANDHOLM	GENEVA	Dry		
<b>Size</b>	<b>Material</b>	<b>Sewer Use</b>	<b>Purpose</b>	<b>Length</b>	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
<b>Comments</b>				<b>Pre-Cleaning</b>	<b>TV Length</b>
				Jetting	269.3

Ftg.	Code	Description	Position	Severity	Comment
0.0	MH	Manhole	12		
2.2	L	Lateral	2		STUB
5.1	R	Roots	2 to 4	3	
7.6	R	Roots	8 to 4	3	
10.5	R	Roots		3	
11.3	C	Crack	3 to 4	2	
42.3	L	Lateral	2		STUB
44.9	L	Lateral	1		
82.1	C	Crack	2 to 5	2	
98.0	L	Lateral	11		STUB
113.4	L	Lateral	2		
137.0	DP	Deposits		2	
141.0	L	Lateral	12		
143.4	L	Lateral	2		STUB
147.8	DP	Deposits	7 to 10	2	
149.4	DP	Deposits		2	
171.9	DP	Deposits		2	
174.6	DP	Deposits		2	
181.5	L	Lateral	11		STUB
183.8	L	Lateral	2		STUB
193.8	L	Lateral	10		
227.9	L	Lateral	2		
227.9	R	Roots		3	
231.7	L	Lateral	2		STUB
234.6	L	Lateral	2		STUB
235.9	C	Crack	1 to 8	2	
269.3	MH	Manhole	12		

<b>Owner</b>	<b>Customer</b>	<b>Upstream MH</b> 3UM33	<b>Downstream MH</b> 3UM37	<b>Date</b> 05-05-2021	<b>Time</b> 9:22 AM
<b>Surveyor</b> NICK	<b>Street</b> SANDHOLM	<b>City</b> GENEVA		<b>Weather</b> Dry	
<b>Size</b> 8	<b>Material</b> Vitrified Clay Pipe	<b>Sewer Use</b> Sanitary	<b>Purpose</b> Routine Assessment		<b>Length</b>
<b>Comments</b>				<b>Pre-Cleaning</b> Jetting	<b>TV Length</b> 269.3

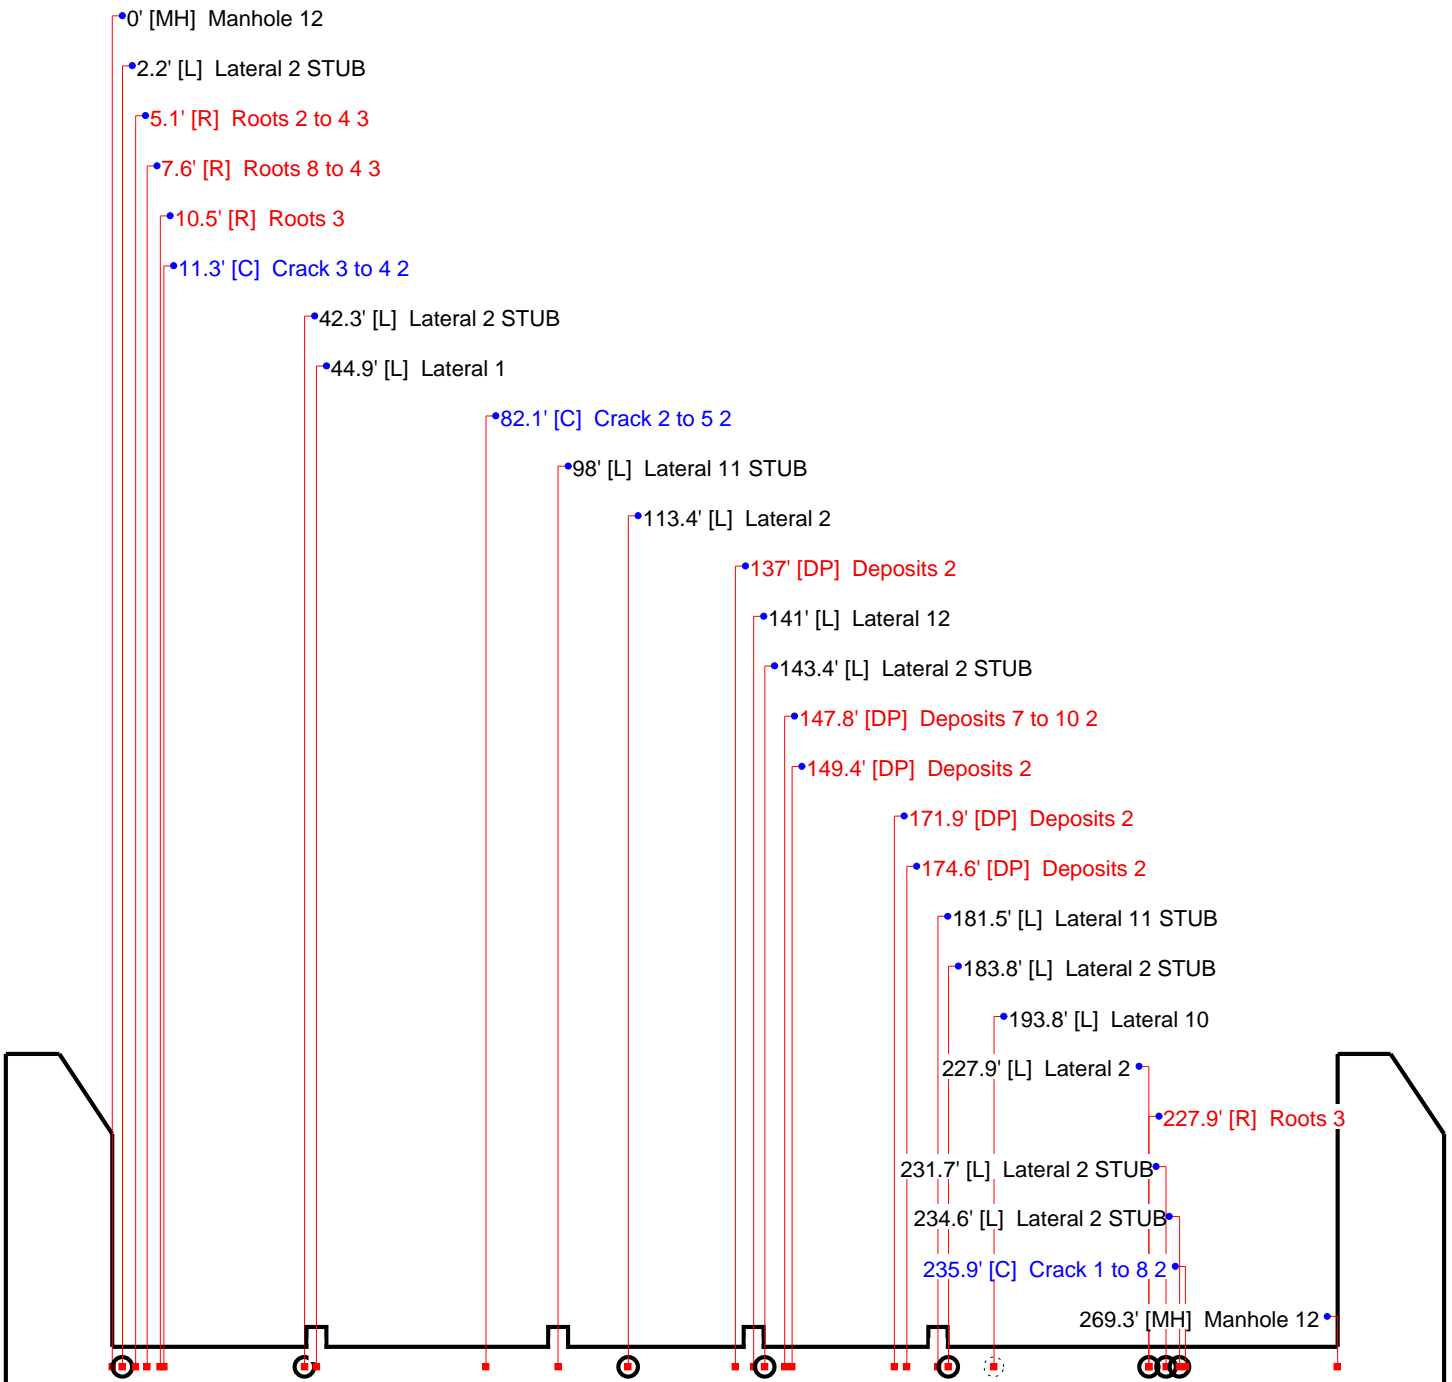

<b>Owner</b>	<b>Customer</b>	<b>Upstream MH</b>	<b>Downstream MH</b>	<b>Date</b>	<b>Time</b>
		3UM33	3UM37	05-05-2021	9:22 AM
<b>Surveyor</b>	<b>Street</b>	<b>City</b>	<b>Weather</b>		
NICK	SANDHOLM	GENEVA	Dry		
<b>Size</b>	<b>Material</b>	<b>Sewer Use</b>	<b>Purpose</b>	<b>Length</b>	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
<b>Comments</b>	<b>Pre-Cleaning</b>	<b>TV Length</b>			
	Jetting	269.3			

### Distance (ft)

