


Owner	Customer	Upstream MH	Downstream MH	Date	Time
		1RM17	1RM23	05-27-2021	8:08 AM
Surveyor	Street	City	Weather		
NICK	RICHARDS	GENEVA	Dry		
Size	Material	Sewer Use	Purpose	Length	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
Comments				Pre-Cleaning	TV Length
				Jetting	297.6

Ftg.	Code	Description	Position	Severity	Comment
0.1	MH	Manhole	12		
0.7	C	Crack	5 to 7	2	
6.7	L	Lateral	9		
6.7	L	Lateral	3		
8.6	L	Lateral	12		STUB
9.4	C	Crack	6 to 6	2	
52.9	L	Lateral	2		
61.1	L	Lateral	10		
77.6	R	Roots	7 to 5	3	
82.1	R	Roots	7 to 9	3	
84.0	R	Roots		3	
90.0	R	Roots	3 to 6	3	
94.2	R	Roots	9 to 9	3	
98.4	R	Roots	8 to 8	3	
100.7	R	Roots	6 to 9	3	
102.9	R	Roots	7 to 9	3	
104.5	L	Lateral	2		
108.5	L	Lateral	2		STUB
110.5	L	Lateral	2		
115.3	R	Roots		3	
117.0	R	Roots	8 to 4	3	
121.2	R	Roots	1 to 5	3	
123.3	R	Roots	2 to 4	3	
131.7	R	Roots		3	
138.2	C	Crack	6 to 6	2	
155.8	L	Lateral	2		
157.7	L	Lateral	11		
196.7	C	Crack	6 to 9	2	
207.7	L	Lateral	2		
209.7	L	Lateral	10		
213.7	C	Crack	6 to 8	2	
245.6	C	Crack	7 to 6	2	
257.1	L	Lateral	2		STUB
259.2	L	Lateral	11		STUB
260.9	L	Lateral	2		
264.5	H	Hole	1 to 5	4	
264.7	L	Lateral	2		
297.6	MH	Manhole	12		

Owner	Customer	Upstream MH	Downstream MH	Date	Time
		1RM17	1RM23	05-27-2021	8:08 AM
Surveyor	Street	City	Weather		
NICK	RICHARDS	GENEVA	Dry		
Size	Material	Sewer Use	Purpose	Length	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
Comments				Pre-Cleaning	TV Length
				Jetting	297.6

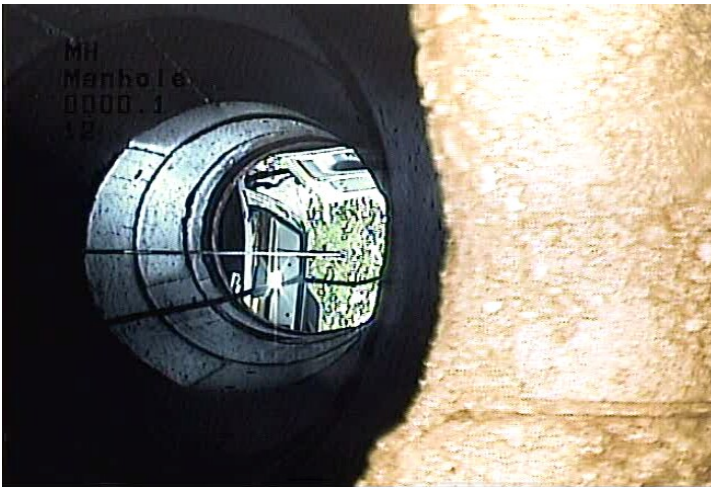

MH - Manhole @ 0.1 ft.



C - Crack @ 0.7 ft.




L - Lateral @ 6.7 ft.




L - Lateral @ 6.7 ft.

Owner	Customer	Upstream MH	Downstream MH	Date	Time
		1RM17	1RM23	05-27-2021	8:08 AM
Surveyor	Street	City	Weather		
NICK	RICHARDS	GENEVA	Dry		
Size	Material	Sewer Use	Purpose	Length	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
Comments	Pre-Cleaning	TV Length			
	Jetting	297.6			

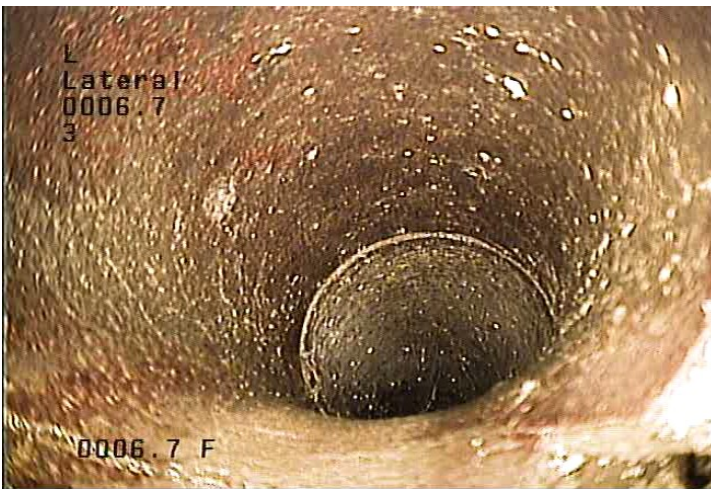

L - Lateral @ 8.6 ft. STUB

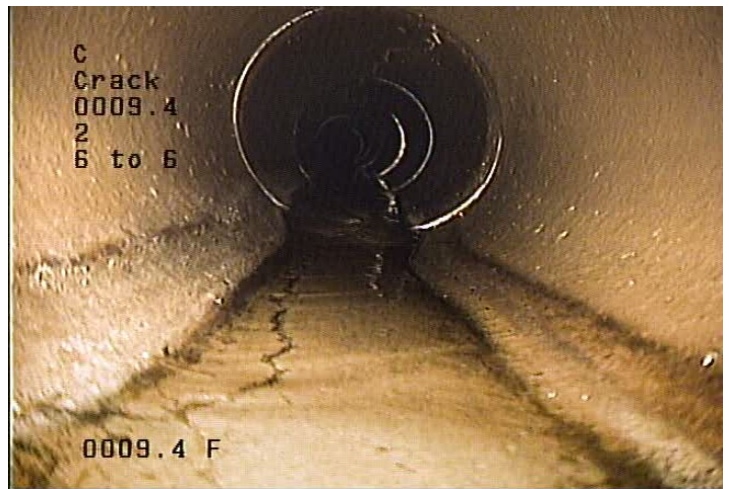

C - Crack @ 9.4 ft.



L - Lateral @ 52.9 ft.




L - Lateral @ 61.1 ft.


Owner	Customer	Upstream MH	Downstream MH	Date	Time
		1RM17	1RM23	05-27-2021	8:08 AM
Surveyor	Street	City	Weather		
NICK	RICHARDS	GENEVA	Dry		
Size	Material	Sewer Use	Purpose	Length	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
Comments				Pre-Cleaning	TV Length
				Jetting	297.6




R - Roots @ 77.6 ft.

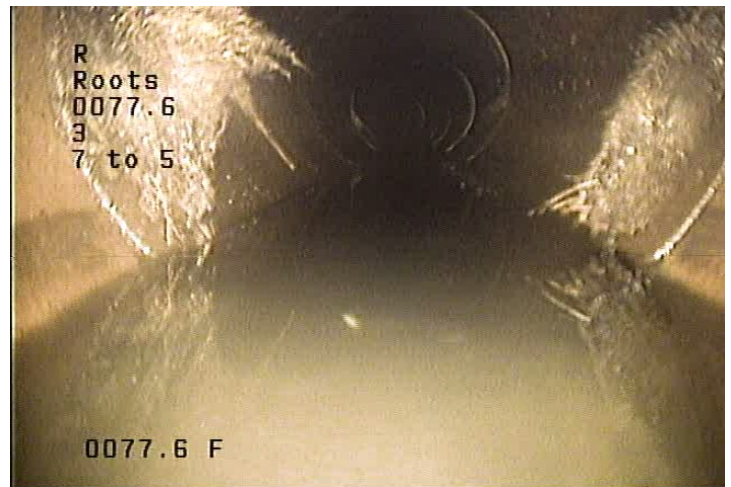

R - Roots @ 82.1 ft.

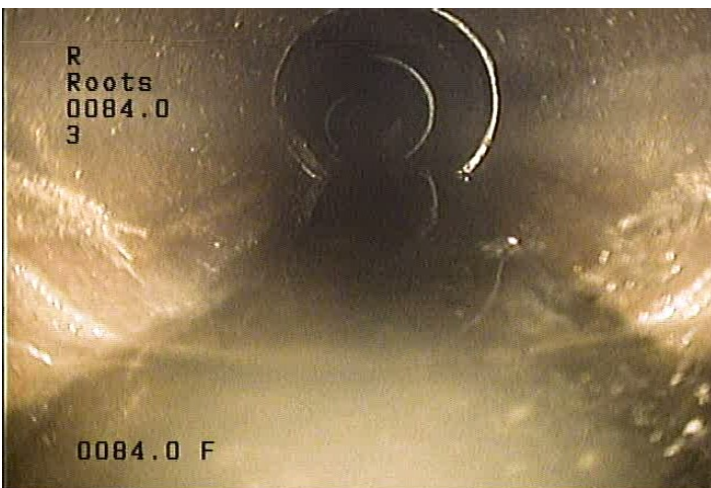


R - Roots @ 84.0 ft.

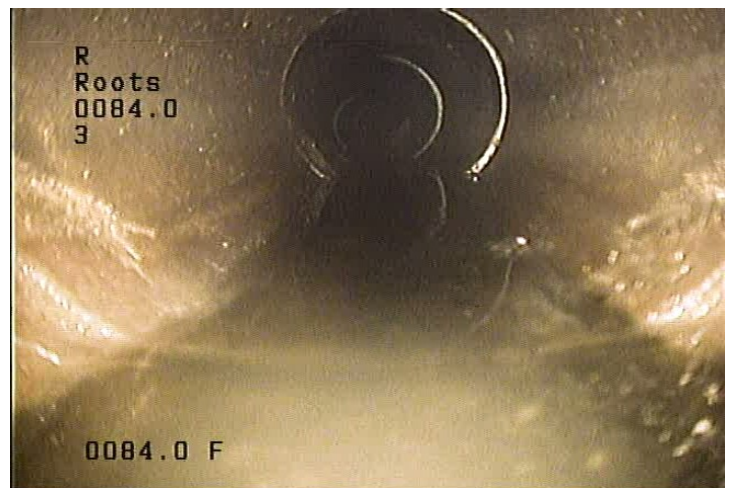


R - Roots @ 90.0 ft.


Owner	Customer	Upstream MH	Downstream MH	Date	Time
		1RM17	1RM23	05-27-2021	8:08 AM
Surveyor	Street	City	Weather		
NICK	RICHARDS	GENEVA	Dry		
Size	Material	Sewer Use	Purpose	Length	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
Comments	Pre-Cleaning	TV Length			
	Jetting	297.6			

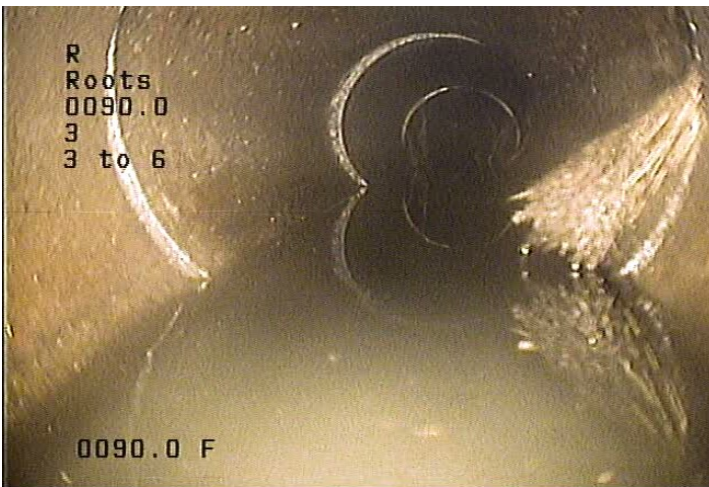


R - Roots @ 94.2 ft.

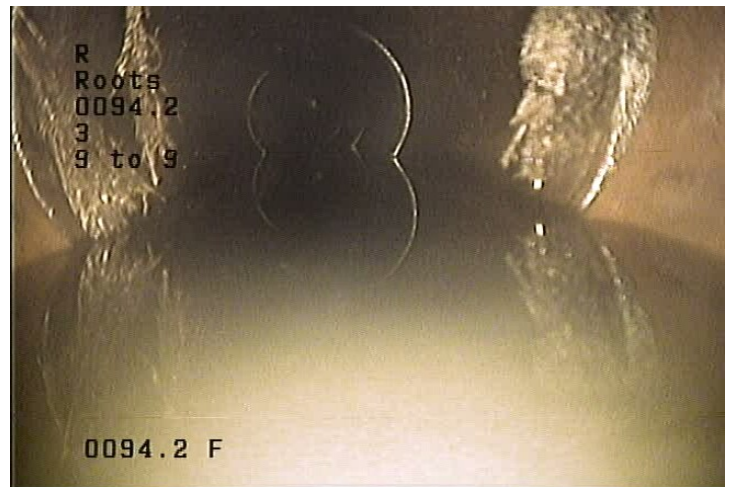

R - Roots @ 98.4 ft.

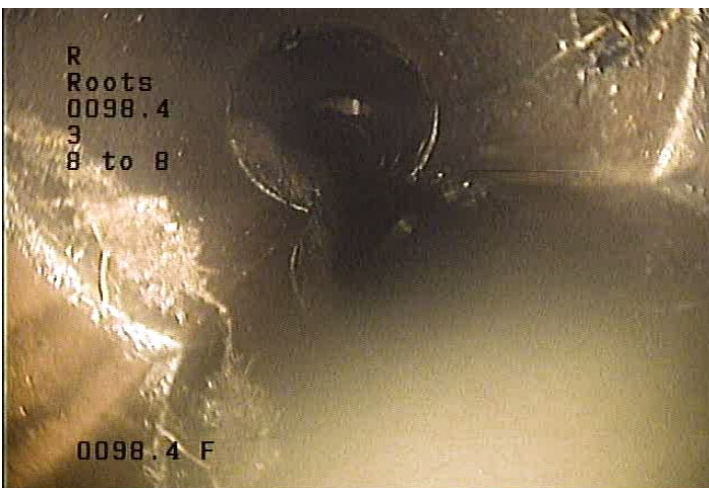


R - Roots @ 100.7 ft.

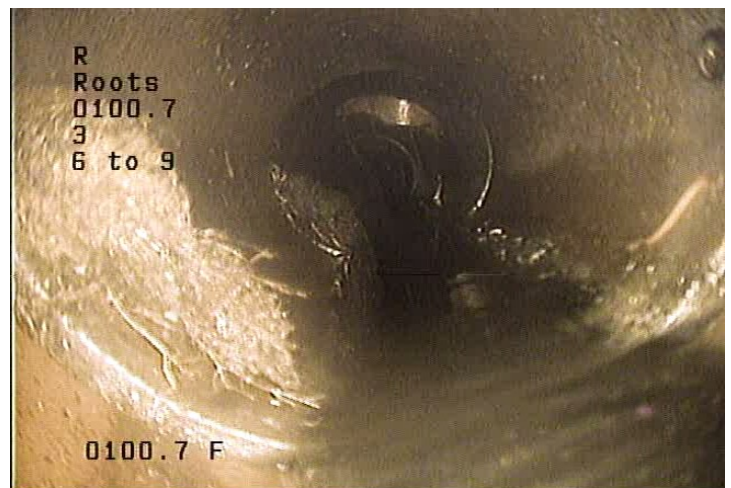

R - Roots @ 102.9 ft.


Owner	Customer	Upstream MH	Downstream MH	Date	Time
		1RM17	1RM23	05-27-2021	8:08 AM
Surveyor	Street	City	Weather		
NICK	RICHARDS	GENEVA	Dry		
Size	Material	Sewer Use	Purpose	Length	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
Comments				Pre-Cleaning	TV Length
				Jetting	297.6

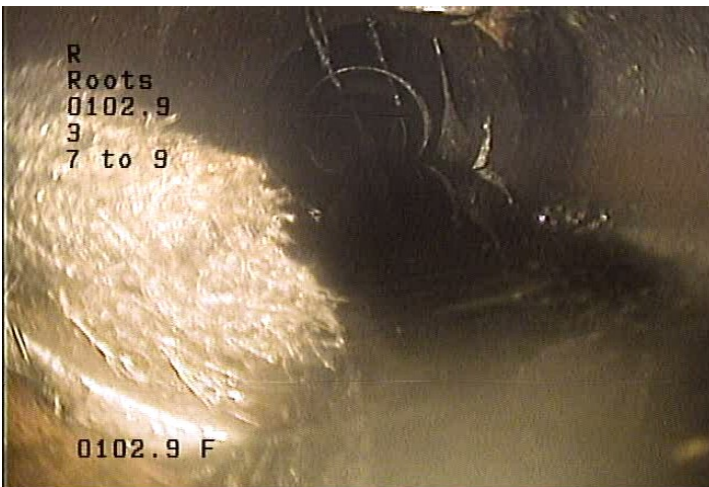

L - Lateral @ 104.5 ft.



L - Lateral @ 108.5 ft. STUB

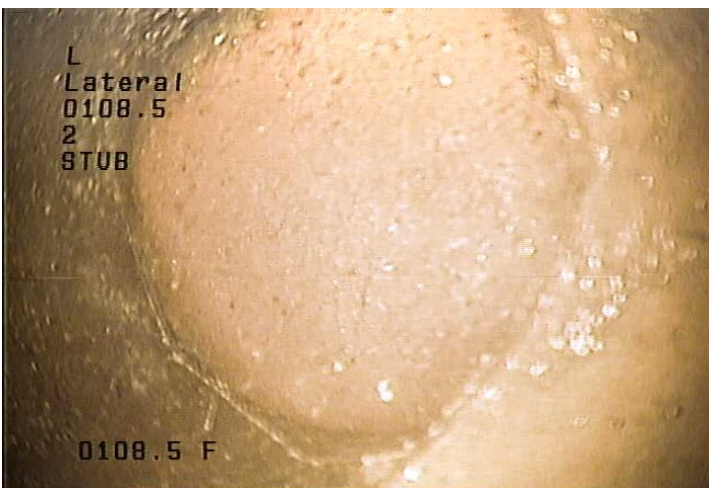


L - Lateral @ 110.5 ft.




R - Roots @ 115.3 ft.


Owner	Customer	Upstream MH	Downstream MH	Date	Time
		1RM17	1RM23	05-27-2021	8:08 AM
Surveyor	Street	City	Weather		
NICK	RICHARDS	GENEVA	Dry		
Size	Material	Sewer Use	Purpose	Length	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
Comments				Pre-Cleaning	TV Length
				Jetting	297.6

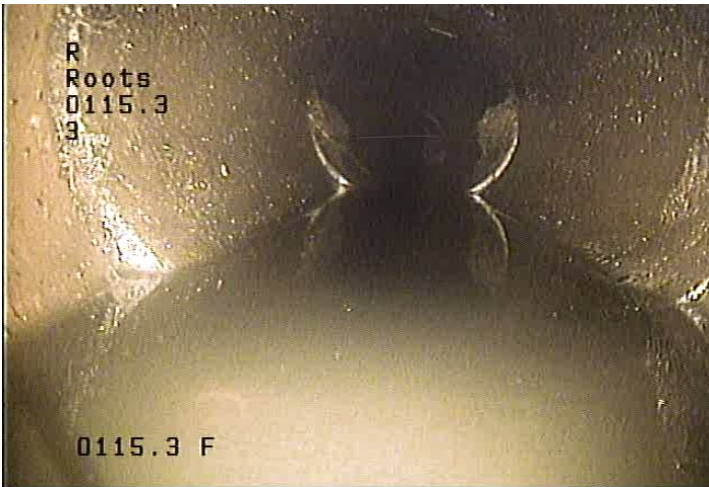


R - Roots @ 117.0 ft.

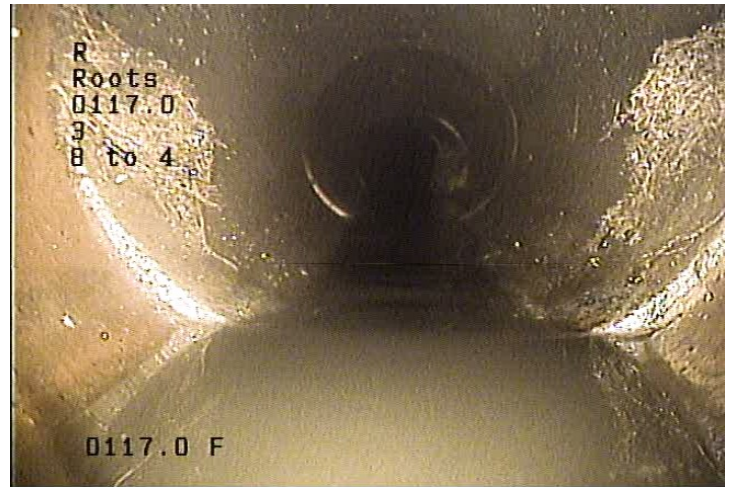

R - Roots @ 121.2 ft.

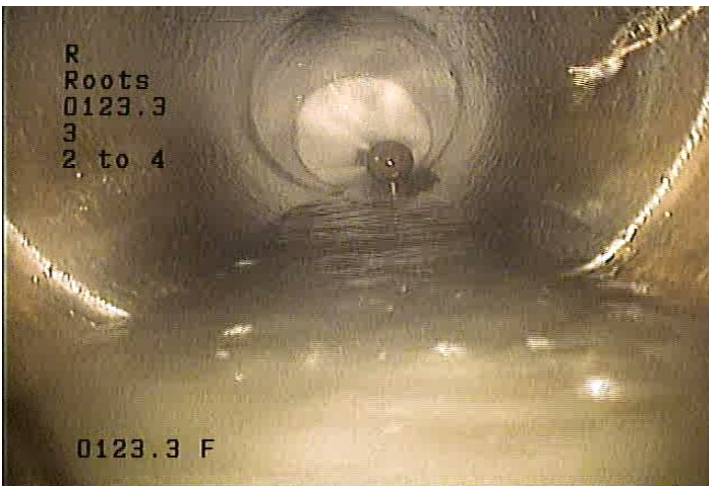

R - Roots @ 123.3 ft.

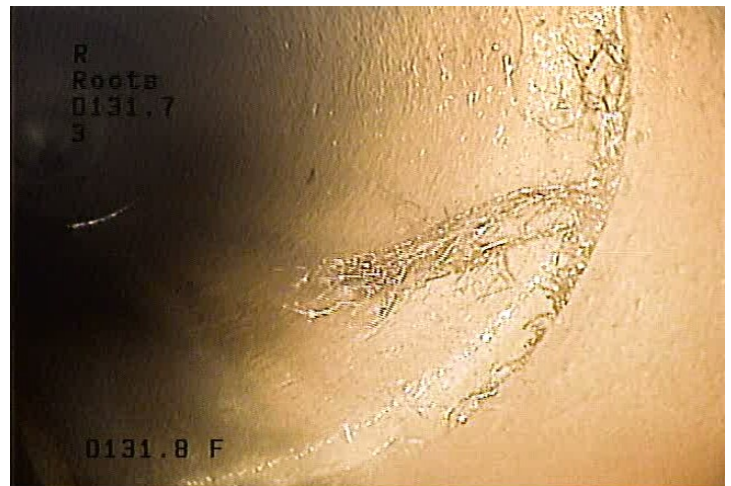


R - Roots @ 131.7 ft.

Owner	Customer	Upstream MH	Downstream MH	Date	Time
		1RM17	1RM23	05-27-2021	8:08 AM
Surveyor	Street	City	Weather		
NICK	RICHARDS	GENEVA	Dry		
Size	Material	Sewer Use	Purpose	Length	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
Comments	Pre-Cleaning	TV Length			
	Jetting	297.6			



C - Crack @ 138.2 ft.

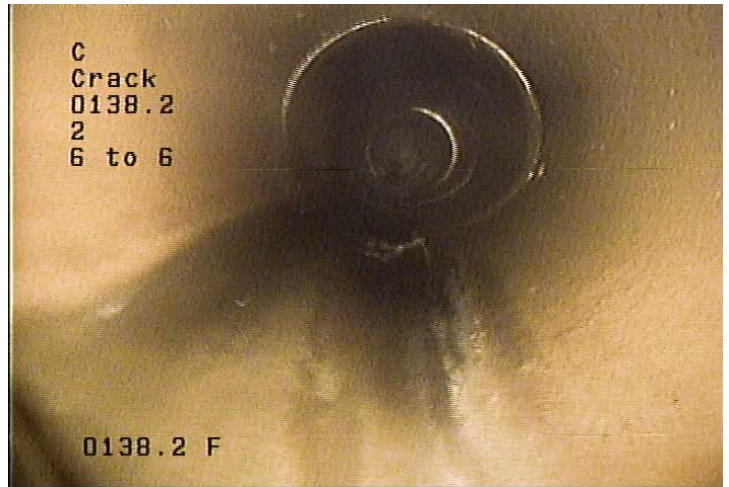

L - Lateral @ 155.8 ft.



L - Lateral @ 157.7 ft.



C - Crack @ 196.7 ft.

Owner	Customer	Upstream MH	Downstream MH	Date	Time
		1RM17	1RM23	05-27-2021	8:08 AM
Surveyor	Street	City	Weather		
NICK	RICHARDS	GENEVA	Dry		
Size	Material	Sewer Use	Purpose	Length	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
Comments	Pre-Cleaning	TV Length			
	Jetting	297.6			




L - Lateral @ 207.7 ft.



L - Lateral @ 209.7 ft.




C - Crack @ 213.7 ft.

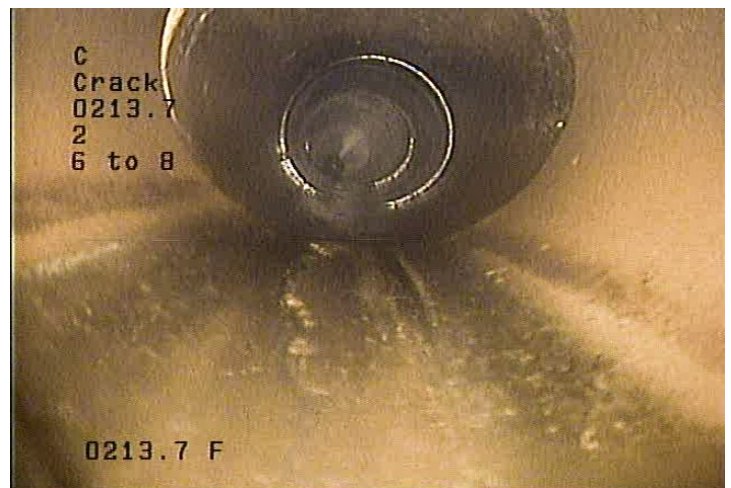

C - Crack @ 245.6 ft.


Owner	Customer	Upstream MH	Downstream MH	Date	Time
		1RM17	1RM23	05-27-2021	8:08 AM
Surveyor	Street	City	Weather		
NICK	RICHARDS	GENEVA	Dry		
Size	Material	Sewer Use	Purpose	Length	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
Comments	Pre-Cleaning	TV Length			
	Jetting	297.6			

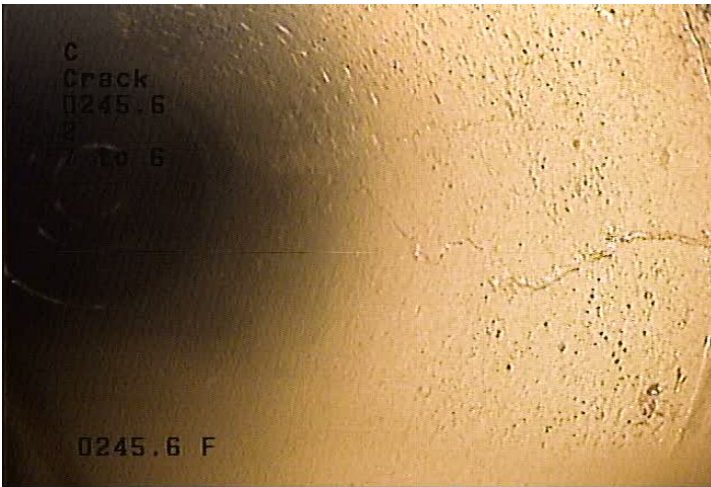


L - Lateral @ 257.1 ft. STUB



L - Lateral @ 259.2 ft. STUB

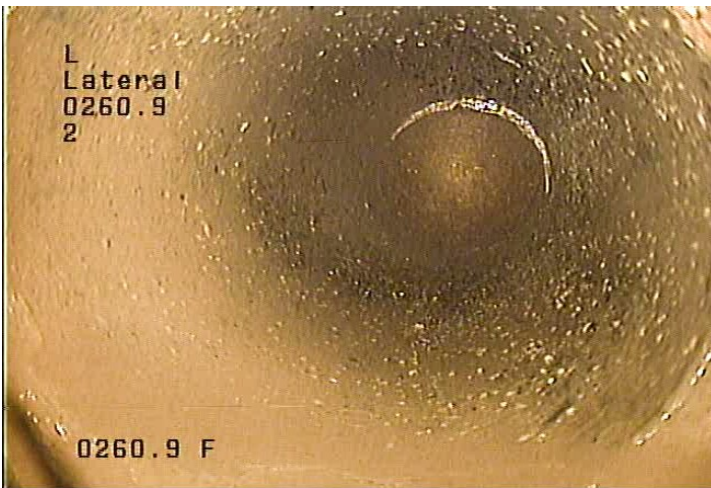


L - Lateral @ 260.9 ft.

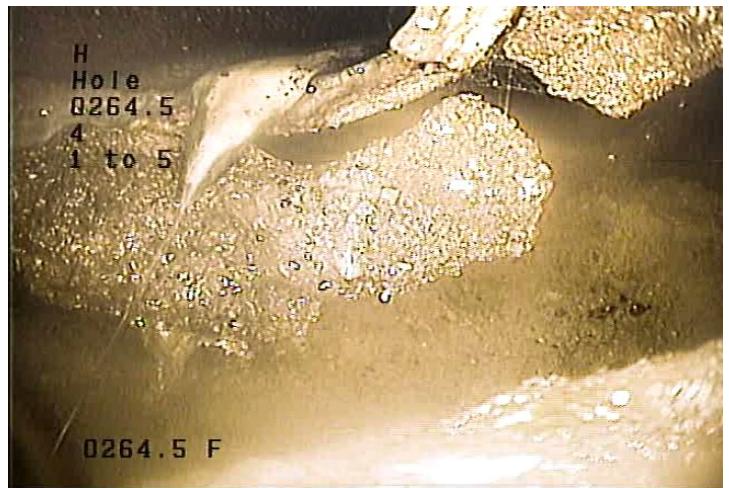

H - Hole @ 264.5 ft.

Owner	Customer	Upstream MH	Downstream MH	Date	Time
		1RM17	1RM23	05-27-2021	8:08 AM
Surveyor	Street	City	Weather		
NICK	RICHARDS	GENEVA	Dry		
Size	Material	Sewer Use	Purpose	Length	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
Comments	Pre-Cleaning	TV Length			
	Jetting	297.6			

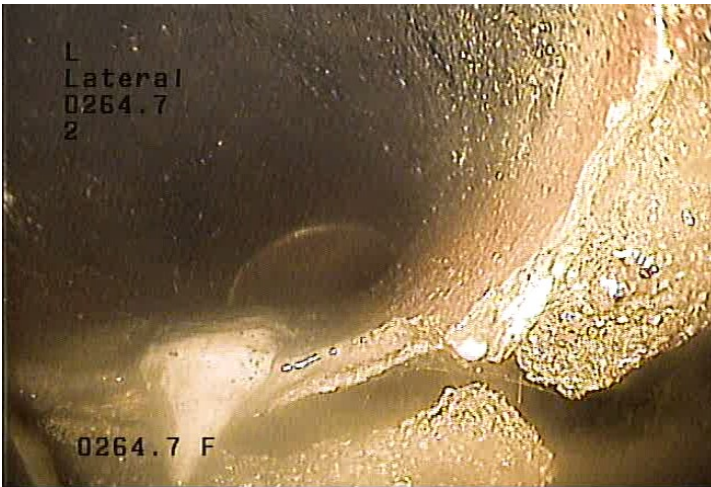

L - Lateral @ 264.7 ft.




MH - Manhole @ 297.6 ft.

Owner	Customer	Upstream MH	Downstream MH	Date	Time
		1RM17	1RM23	05-27-2021	8:08 AM
Surveyor	Street	City	Weather		
NICK	RICHARDS	GENEVA	Dry		
Size	Material	Sewer Use	Purpose	Length	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
Comments				Pre-Cleaning	TV Length
				Jetting	297.6

Ftg.	Code	Description	Position	Severity	Comment
0.1	MH	Manhole	12		
0.7	C	Crack	5 to 7	2	
6.7	L	Lateral	9		
6.7	L	Lateral	3		
8.6	L	Lateral	12		STUB
9.4	C	Crack	6 to 6	2	
52.9	L	Lateral	2		
61.1	L	Lateral	10		
77.6	R	Roots	7 to 5	3	
82.1	R	Roots	7 to 9	3	
84.0	R	Roots		3	
90.0	R	Roots	3 to 6	3	
94.2	R	Roots	9 to 9	3	
98.4	R	Roots	8 to 8	3	
100.7	R	Roots	6 to 9	3	
102.9	R	Roots	7 to 9	3	
104.5	L	Lateral	2		
108.5	L	Lateral	2		STUB
110.5	L	Lateral	2		
115.3	R	Roots		3	
117.0	R	Roots	8 to 4	3	
121.2	R	Roots	1 to 5	3	
123.3	R	Roots	2 to 4	3	
131.7	R	Roots		3	
138.2	C	Crack	6 to 6	2	
155.8	L	Lateral	2		
157.7	L	Lateral	11		
196.7	C	Crack	6 to 9	2	
207.7	L	Lateral	2		
209.7	L	Lateral	10		
213.7	C	Crack	6 to 8	2	
245.6	C	Crack	7 to 6	2	
257.1	L	Lateral	2		STUB
259.2	L	Lateral	11		STUB
260.9	L	Lateral	2		
264.5	H	Hole	1 to 5	4	
264.7	L	Lateral	2		
297.6	MH	Manhole	12		

Owner	Customer	Upstream MH 1RM17	Downstream MH 1RM23	Date 05-27-2021	Time 8:08 AM
Surveyor NICK	Street RICHARDS	City GENEVA		Weather Dry	
Size 8	Material Vitrified Clay Pipe	Sewer Use Sanitary	Purpose Routine Assessment		Length
Comments				Pre-Cleaning Jetting	TV Length 297.6

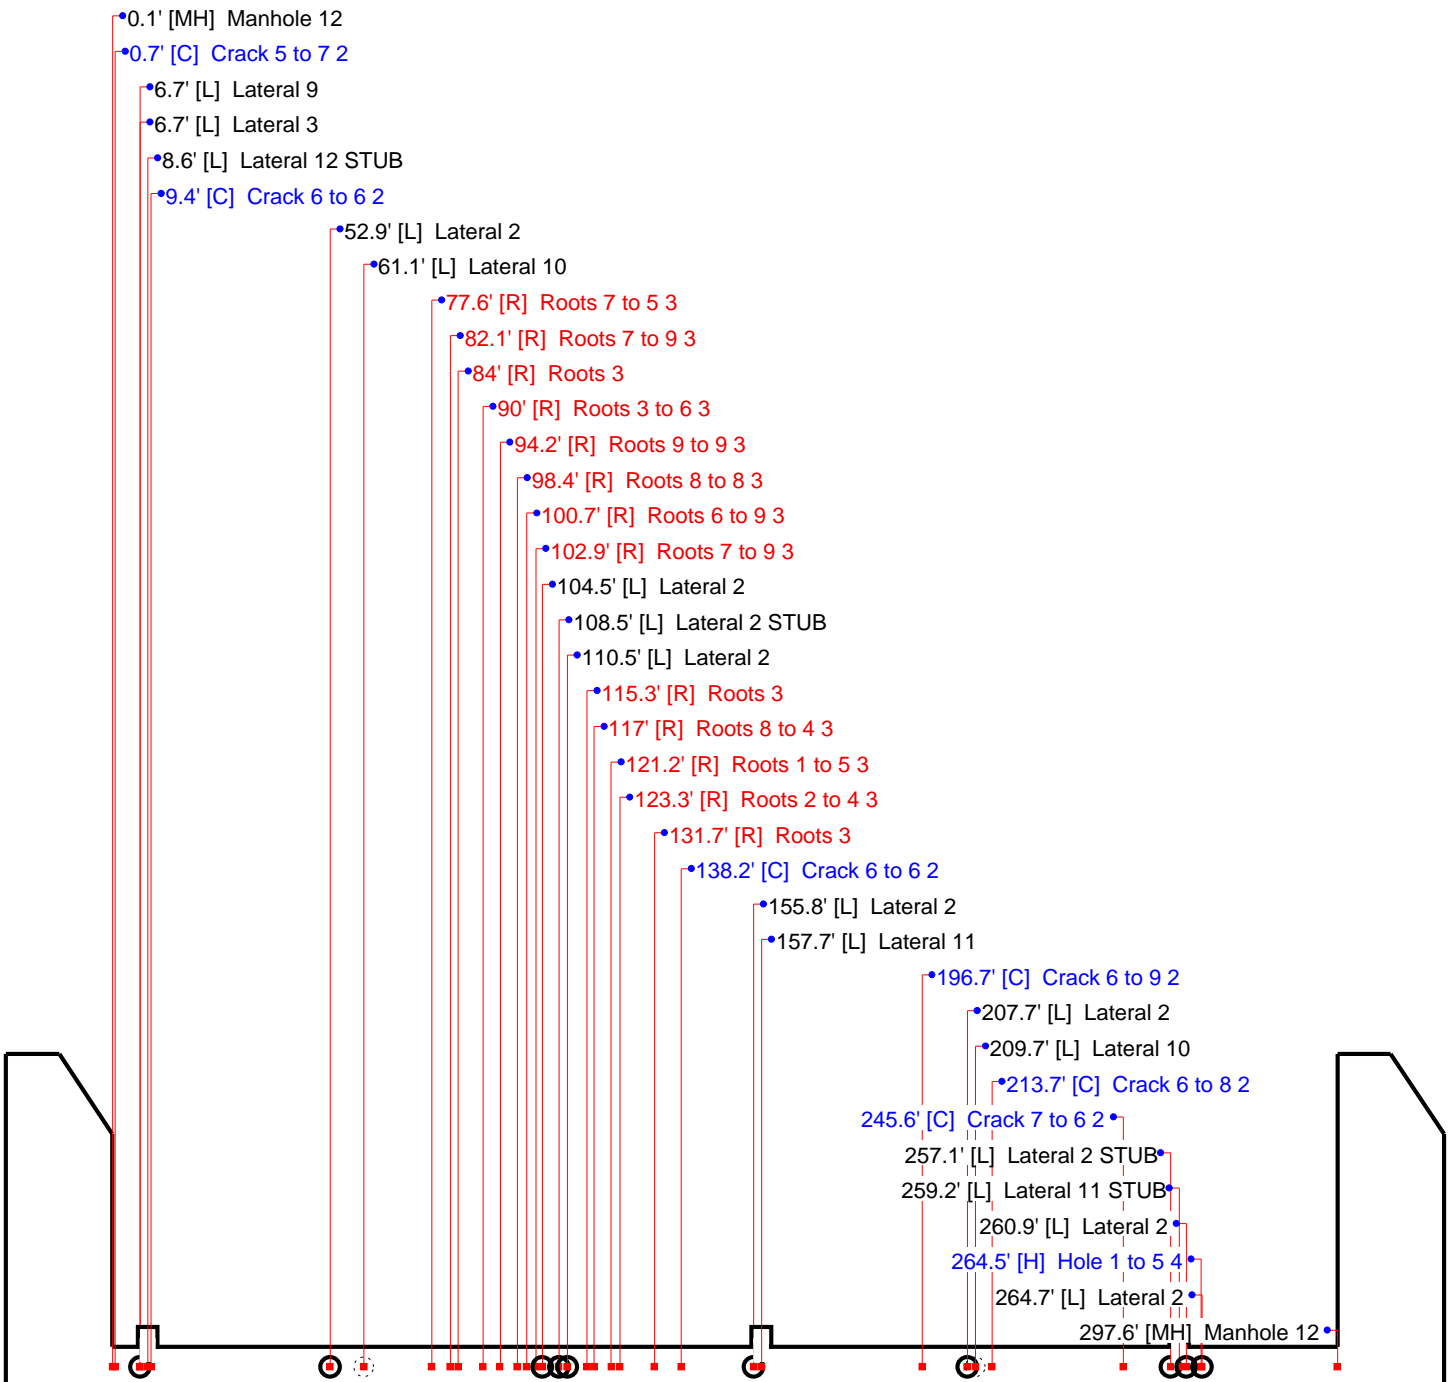

Owner	Customer	Upstream MH	Downstream MH	Date	Time
		1RM17	1RM23	05-27-2021	8:08 AM
Surveyor	Street	City	Weather		
NICK	RICHARDS	GENEVA	Dry		
Size	Material	Sewer Use	Purpose	Length	
8	Vitrified Clay Pipe	Sanitary	Routine Assessment		
Comments	Pre-Cleaning	TV Length			
	Jetting	297.6			

Distance (ft)

